


TO ENSURE CONFORMABILITY SLIGHTLY HEAT THE SURFACE OF THE TPO MEMBRANE USING HOT AIR WELDER

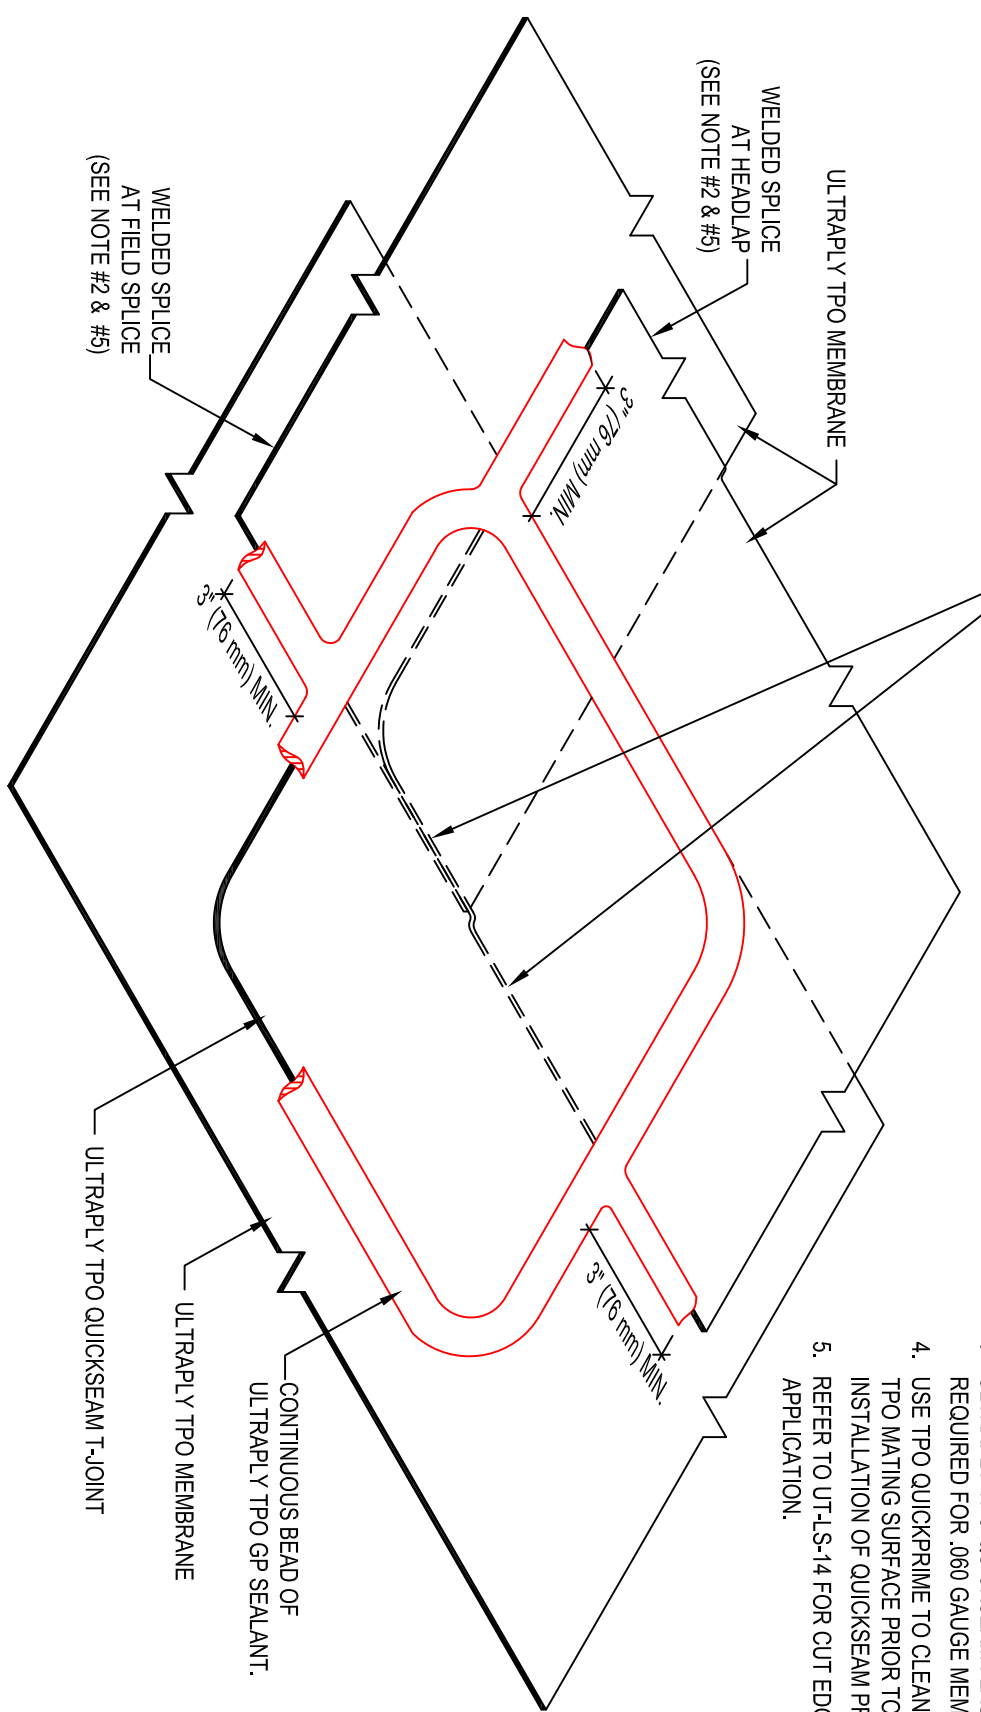

- NOTES:
1. REFER TO FIRESTONE WEBSITE FOR MOST CURRENT INFORMATION.
  2. REFER TO DETAIL UT-LS-1, UT-LS-2, OR UT-LS-3 FOR WELD WIDTH.
  3. ULTRAPLY TPO QUICKSEAM FLASHING REQUIRED FOR .060 GAUGE MEMBRANE ONLY.
  4. USE TPO QUICKPRIME TO CLEAN AND PRIME TPO MATING SURFACE PRIOR TO INSTALLATION OF QUICKSEAM PRODUCTS.
  5. REFER TO UT-LS-14 FOR CUT EDGE SEALANT APPLICATION.

CONTINUOUS BEAD OF ULTRAPLY TPO GP SEALANT.

MAXIMUM WARRANTY: **20 YEARS**

**LAP SPLICE WITH HEADLAP OVER FIELD SEAM USING TPO QUICKSEAM T-JOINT**

ULTRAPLY™ TPO

ACCEPTABLE SYSTEMS: ALL

ISSUE / REVISION DATE:

6/24/2014

DETAIL NO.

**UT-LS-9**